

Applicant : Hartley Owen
Filed : 07/16/2003
TC/A.U. : 1764
Examiner : Unknown

Docket No. : RDS01

Mail Stop Non Fee Amendments
Commissioner for Patents
P.O. Box 1450
Alexandria VA 22313-1450

INFORMATION DISCLOSURE STATEMENT

Sir:

This IDS reviews the problem, the invention and the closest art known.

PROBLEM – THERMAL CRACKING IN A CATALYTIC CRACKER

FCC units have evolved to use all riser cracking, with cyclones on the riser outlet to rapidly separate cracked products from spent catalyst which was sent down to the stripper. Stripping steam recovers additional cracked product from spent catalyst, but the stripper vapor spends a long time in the reactor vessel and thermally cracks. The reactor vessels are large and the stripper vapor residence time is excessive, because many of the vessels were sized to handle both vapor from the riser and the stripper. Closed cyclones improved yields from the riser and created an unwanted thermal cracking zone above the stripper.

THE SOLUTION – AN INVERTED SNORKEL

Inventor Owen devised a way to get stripper vapor out of the reactor vessel quickly, to reduce thermal cracking. The device operates like an upside down snorkel, quickly removing cracked product from above the stripper, minimizing thermal cracking. The snorkel solves another problem in FCC units, a vapor removal device which can withstand huge temperature swings and years of “sandblasting” in the FCC unit. The snorkel can be attached to, or be part of, the primary cyclone.

THE ART:

Closed cyclone systems were developed and/or used by most refiners. US 5,055,177, Haddad et al is a good closed cyclone design.

Riser quench, in which feed and/or catalyst enter the reactor extra hot, and the riser contents quenched in transit, allows catalytic cracking to occur at high temperature, and reduces temperature to reduce thermal cracking downstream of the riser. This reduces, but does not eliminate, thermal cracking. US 4,818,372 and US 5,389,232 disclose riser quench .

Post riser quenching is disclosed in US 4,978,440.

A stripper cap disclosed in US 4,946,656 isolates the FCC stripper to facilitate removal of stripper vapor. Thermal cracking is still a problem for stripper vapor passing through the cap of the stripper into the reactor vessel. '656 recognized some of the problem (thermal cracking of stripper vapors) but provided only a partial solution with an approach which could be hard to implement, mechanically, in an FCC.

Early action is respectfully solicited. If the Examiner believes patentable subject matter is present, but there are concerns about claim language, a telephone interview is invited.


Respectfully submitted



Richard D. Stone

Reg. No. 27,598

Tel.: (504) 367-1933 or Cell # (504) 352-2494

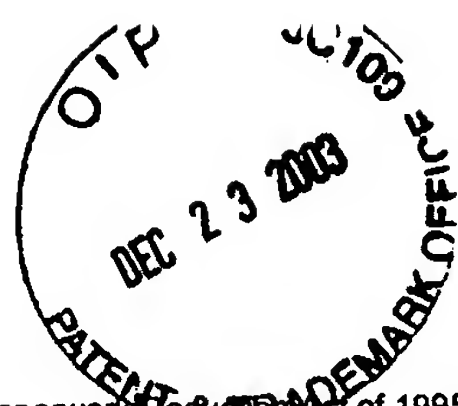

Under the Paperwork Reduction Project of 1995, no persons are required to respond to a collection of information unless it contains a valid OMB control number.

Complete if Known

Application Number	10/621,197
Filing Date	07/16/2003
First Named Inventor	HARTLEY OWEN
Art Unit	1764
Examiner Name	
Attorney Docket Number	RD501

(Use as many sheets as necessary)

Sheet

1

of

1

[illegible][illegible]

Date
Considered

This collection of information is required by 37 CFR 1.97 and 1.98. The information is required to obtain or retain a benefit by the public which is to file (and by the USPTO to process) an application. Confidentiality is governed by 35 U.S.C. 122 and 37 CFR 1.14. This collection is estimated to take 2 hours to complete, including gathering, preparing, and submitting the completed application form to the USPTO. Time will vary depending upon the individual case. Any comments on the amount of time you require to complete this form and/or suggestions for reducing this burden, should be sent to the Chief Information Officer, U.S. Patent and Trademark Office, U.S. Department of Commerce, P.O. Box 1450, Alexandria, VA 22313-1450. DO NOT SEND FEES OR COMPLETED FORMS TO THIS ADDRESS. **SEND TO: Commissioner for Patents, P.O. Box 1450, Alexandria, VA 22313-1450.**

If you need assistance in completing the form, call 1-800-PTO-9199 and select option 2.